

A SELECTION FROM THE VAST RANGE OF

ClarkeTM

QUALITY PRODUCTS

AIR COMPRESSORS

From DIY to industrial. Plus air tools, spray guns and accessories.

GENERATORS

Prime duty or emergency standby for business, home and leisure.

POWER WASHERS

Hot and cold, electric and engine driven - we have what you need.

WELDERS

Mig, Arc, Tig and Spot. From DIY to auto/industrial.

METALWORKING

Drills, grinders and saws for DIY and professional use.

WOODWORKING

Saws, sanders, lathes, mortisers and dust extraction.

HYDRAULICS

Cranes, body repair kits, transmission jacks for all types of workshop use.

WATER PUMPS

Submersible, electric and engine driven for DIY, agriculture and industry.

POWER TOOLS

Angle grinders, cordless drill sets, saws and sanders.

STARTER/CHARGERS

All sizes for car & commercial use.



Clarke[®] INTERNATIONAL

For spare parts and servicing, please contact your nearest dealer, or Clarke International on

020 - 8988 - 7400

e-mail: Parts@clarkeinternational.com e-mail: Service@clarkeinternational.com

ClarkeTM

weld



**PRO-90 MIG
MIG 100E
MIG 150TE**

0402

**OPERATING & MAINTENANCE
INSTRUCTIONS**



CONTENTS

PAGE

Guarantee	3
Parts & Service Contacts	3
Electromagnetic Interference (EMC)	4
Safety Precautions	6
Additional Safety Precautions for MIG Welding	11
Principles of Operation	13
Electrical Connections	14
Unpacking and Parts Identification	15
Assembly	Loose Components
	16
	Installing the Welding Wire
	16
	Selecting the Drive Roller Groove
	18
	Connecting the Gas Supply
	19
	Welding Shield
	20
Preparation for Use	Preparing the Work
	21
	Setting the Controls
	21
	Welding Wire Preparation
	23
	Attaching the Earth Clamp
	23
MIG Welding Operation 23	
	Thermal Overload
	24
Welding Tips	24
Maintenance	25
	Renewing the Wire Liner
	26
Control Settings Reference Tables	27-29
Welder Specifications	30
Wiring Diagrams	30-31
Parts Lists and Diagrams 32-33	
Troubleshooting	34
Accessories	35
Parts & Service Contacts	35

ACCESSORIES

The following accessories are available from your Clarke dealer. Please quote the part numbers shown below:

1. Welding Wire Spools

	Mild Steel	Stainless Steel	Aluminium
Mini - 0.6mm	6000641	-	-
Mini - 0.8mm	6000481	6000498	6000483
5kg - 0.6mm	6000476	-	-
5kg - 0.8mm	6000475	-	-

2. Welding Gas

CO ₂ (250g)	6000642	For welding Mild Steel
CO ₂ (600g)	6000643	For welding Mild Steel
Argon	6000661	For welding Aluminium
CO ₂ /Argon Mix	6000660	For welding Stainless/Thin Sheet MS

3. Welding Tips

0.6mm (pack of 5)	8132260
0.8mm (pack of 5)	8132270

4. Gas Regulator

8132000

In addition to the above, your Clarke dealer can provide you with a wide range of welding accessories, safety equipment etc., to increase productivity where necessary and to simplify and assist in the welding process.

PARTS AND SERVICE CONTACTS

For Spare Parts and Service, please contact your nearest dealer, or CLARKE International, on one of the following numbers.

PARTS & SERVICE TEL: 020 8988 7400

PARTS & SERVICE FAX: 020 8558 3622

or e-mail as follows:

PARTS: Parts@clarkeinternational.com

SERVICE: Service@clarkeinternational.com

TROUBLESHOOTING

Your **Clarke** Mig Welder has been designed to give long and trouble free service. If, however, having followed the instructions in this booklet carefully, you still encounter problems, the following points should help identify and resolve them.

PROBLEM	CAUSE	REMEDY
1. No "life" from welder	Check fuses and mains lead	a) Replace fuses as necessary If problem persists return welder to your local dealer b) Check fuse size
2. No wire feed	Motor malfunction	Return welder to your local dealer
3. Feed motor operates but wire will not feed	a) Insufficient Feed Roller Pressure b) Burr on end of wire c) Liner blocked or damaged d) Inferior wire e) Roller worn out	a) Increase roller pressure b) Re-cut wire square with no burr c) Clean with compressed air or replace liner. d) Use only good "clean" wire e) Replace roller
4. Wire welds itself to tip	a) Wire feed speed too low b) Wrong size tip	a) Unscrew tip, cut wire and fit new tip Increase wire speed before operating again b) Fit correct size tip
5. Wire feeds into 'birds nest' tangle	a) Wire welded to tip b) Wire liner damaged preventing smooth operation	a) As above plus reduce feed roller pressure so that if blockage occurs wire slips on roller i.e. no feed b) Renew wire liner
6. Loose coils of wire tangle around wire drum inside machine	Drum brake too slack	Tighten drum brake Caution: Do not over-tighten
7. Erratic wire feed	a) Drum brake too tight b) Feed roller worn c) Insufficient pressure on feed roller d) Wire dirty, rusty, damp or bent e) Liner partially blocked	a) Loosen drum brake slightly b) Check and replace if necessary c) Increase pressure on feed roller Caution: Do not over-tighten d) Re-cut wire and ensure it is clean e) Clean with compressed air
8. Poor quality welds	a) Insufficient gas at weld area b) Incorrect gas/wire combination c) Rusty, painted, damp, oil or greasy workpiece d) Rusty/dirty wire e) Poor earth contact	a) Check that gas is not being blown away by draughts and if so move to more sheltered weld area. If not increase gas supply b) Consult your MIG welding manual for correct set-up c) Ensure workpiece is clean and dry d) Ensure wire is clean and dry e) Check earth clamp/workpiece conn
9. Wire jams in tip when welding aluminium	Tip too small	Use slightly oversize tip ie., for .8mm wire use 1mm tip. (Note: Applies to aluminium only)
10. Welder cuts out whilst in use	Duty cycle exceeded (auto cut-out operates)	Allow welder to cool 15-30 mins before continuing <i>Note: If duty cycle is continually exceeded, damage to the welder may result, and welder output is probably too small for application</i>

If you have any problems which cannot be resolved by reference to the above, or if you require spare parts for your welder please contact your local Clarke dealer.

Thank you for purchasing this CLARKE MIG Welder.

Before attempting to operate the machine, it is essential that you read this manual thoroughly and carefully follow all instructions given. In doing so you will ensure the safety of yourself and that of others around you, and you can also look forward to the welder giving you long and satisfactory service.

GUARANTEE

This CLARKE product is guaranteed against faulty manufacture for a period of 12 months from the date of purchase. Please keep your receipt as proof of purchase.

This guarantee is invalid if the product is found to have been abused or tampered with in any way, or not used for the purpose for which it was intended.

Faulty goods should be returned to their place of purchase, no product can be returned to us without prior permission.

This guarantee does not effect your statutory rights.

PARTS AND SERVICE CONTACTS

For Spare Parts and Service, please contact your nearest dealer, or CLARKE International, on one of the following numbers.

PARTS & SERVICE TEL: 020 8988 7400

PARTS & SERVICE FAX: 020 8558 3622

or e-mail as follows:

PARTS: Parts@clarkeinternational.com

SERVICE: Service@clarkeinternational.com

ELECTROMAGNETIC INTERFERENCE (EMC)

Whilst this unit complies with EMC regulations, the user is responsible for installing and using the welding equipment according to the manufacturers instructions. If electromagnetic disturbances are detected then it shall be the responsibility of the user of the welding equipment to resolve the situation. In some cases this remedial action may be as simple as earthing the welding circuit, see 'Note'. In other cases it could involve constructing an electromagnetic screen enclosing the power source and the work complete with associated input filters. In all cases electromagnetic disturbances must be reduced to the point where they are no longer troublesome.

Note - The welding circuit may or may not be earthed for safety reasons. Changing the earthing arrangements should only be authorised by a person who is competent to assess whether the changes will increase the risk of injury, e.g. by allowing parallel welding current return paths which may damage the earth circuits of other equipment.

1. ASSESSMENT OF AREA

Before installing welding equipment the user shall make an assessment of potential electromagnetic problems in the surrounding area. Avoid using your welder in the vicinity of:

- a) other supply cables, control cables, signalling and telephone cables; above, below and adjacent to the welding equipment;
- b) radio and television transmitters and receivers;
- c) computer and other control equipment;
- d) safety critical equipment, e.g. guarding of industrial equipment;
- e) pacemakers and hearing aids etc.;
- f) equipment used for calibration or measurement;
- g) other equipment in the environment. The user shall ensure that other equipment being used in the environment is compatible. This may require additional protection measures;

It may be possible to avoid the above by changing the time of day that welding or other activities are to be carried out.


The size of the surrounding area to be considered will depend on the structure of the building and other activities that are taking place. The surrounding area may extend beyond the boundaries of the premises.

2. METHODS OF REDUCING EMISSIONS

2.1 Mains supply

Welding equipment should be connected to the mains supply according to the manufacturers recommendations. If interference occurs, it may be necessary to

PARTS DIAGRAM

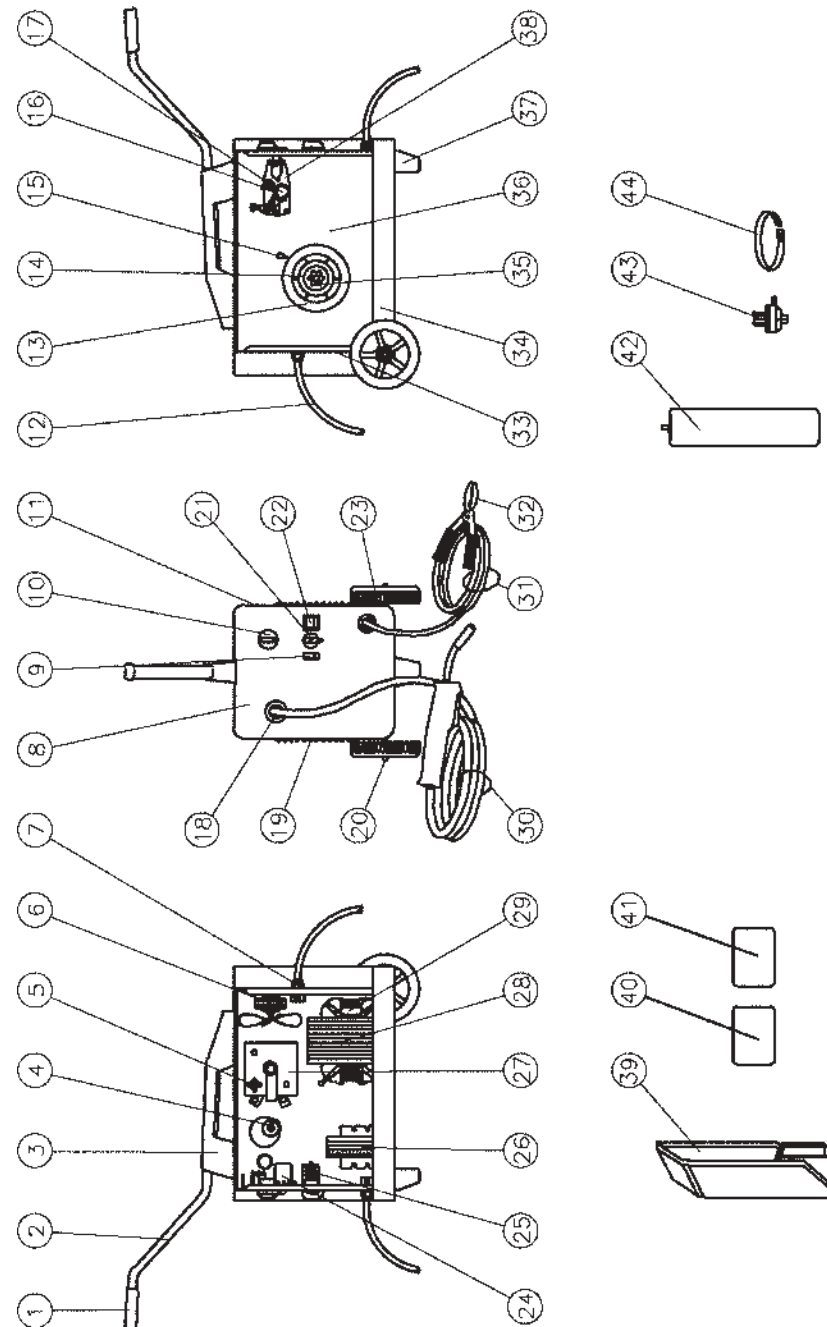

PARTS LIST

No.	Description	PRO-90	100E	150TE
01	Handle-extension Knob	-	-	EN21600006
02	Handle-extention	-	-	EN33725015
03	Handle	EN21600003	EN21600003	EN21600003
04	Complete Motor	EN22810001	EN22810001	EN04600146
05	Complete Thermostat	EN04600126	EN04600113	EN04600126
06	Complete Fan	-	-	EN04600055
07	Cable Clamp	EN21605010	EN21605010	EN21605010
08	Front Panel	EN33710033	EN33710034	EN33710190
09	Welding Current Switch	EN22200006	EN22200006	EN22200006
10	Potentiometer Knob	EN21690018	EN21690018	EN21690018
11	Right-upper Panel	EN33705031	EN33705031	EN33705031
12	Input Cable	EN20220068	EN20220068	EN20220014
13	Mild-steel Wire Spool	See Accessories	See Accessories	See Accessories
14	Spool Holder Retaining Ring	EN21690012	EN21690012	EN21690012
15	Fixed Spool Holder	EN21690011	EN21690011	EN21690011
16	Ball Bearing	EN21500001	EN21500001	EN21500001
17	Wire Feed Roll	EN33805074	EN33805074	EN33805074
18	Torch Grommet On Front Panel	EN21690001	EN21690001	EN21690001
19	Left-upper Panel	EN33705032	EN33705032	EN33705032
20	Wheels Axle	-	-	EN55200033
21	Switch Knob	-	-	EN21690015
22	Yellow Pilot-light Switch	EN22200022	EN22200022	EN22200022
23	Plastic Wheel	-	-	EN21625034
24	P.c. Board	EN22710043	EN22710043	EN22710043
25	Switch	-	-	EN22205001
26	Choke	EN44135001	EN44135002	EN44135004
27	Rectifier	EN22400001	EN22400021	EN22400038
28	Transformer	EN44120067	EN44120071	EN44120052
29	Thermostat	-	-	EN22210016
30	Torch With Rubber Wire Liner	EN23000001	EN23000003	EN23000062
31	Earth Cable	EN43210001	EN43210021	EN43210021
32	Earth Clamp	EN22110005	EN22110005	EN22110005
33	Back Panel	EN33715015	EN33715015	EN33715015
34	Lower Panel	EN33700044	EN33700044	EN33700044
35	Spool Holder Handwheel	EN21800036	EN21800036	EN21800036
36	Dividing Panel	EN33720115	EN33720115	EN33720115
37	Plastic Foot	-	-	EN21610009
38	Plastic Wire Feeder	EN44400017	EN44400017	EN44400019
39	Plastic Mask W/handle	EN21905018	EN21905018	EN21905018
40	Transparent Glass	EN21905020	EN21905020	EN21905020
41	Dark Glass	EN21905021	EN21905021	EN21905021
42	Spare Cartridge C02	See Accessories	See Accesories	See Accessories
43	Reducer W/out Gauge	EN2290S001	EN22905001	EN22905001
44	Hose Clamp	EN2291S004	EN22915004	EN22915004

take additional precautions such as filtering of the mains supply. Consideration should be given to shielding the supply cable of permanently installed welding equipment, in metallic conduit or equivalent. Shielding should be electrically continuous throughout its length. The shielding should be connected to the welding power source so that good electrical contact is maintained between the conduit and the welding power source enclosure.

2.2 Maintenance of the welding equipment

The welding equipment should be routinely maintained according to the manufacturers recommendations. All access and service doors and covers should be closed and properly fastened when the welding equipment is in operation. The welding equipment should not be modified in any way except for those changes and adjustments covered in the manufacturers instructions. In particular, the spark gaps of arc striking and stabilizing devices should be adjusted and maintained according to the manufacturers recommendations.

2.3 Welding cables

The welding cables should be kept as short as possible and should be positioned close together, running at or close to the floor level.

2.4 Equipotential bonding

Bonding of all metallic components in the welding installation and adjacent to it should be considered. However, metallic components bonded to the work piece will increase the risk that the operator could receive a shock by touching these metallic components and the electrodes at the same time. The operator should be insulated from all such bonded metallic components.

2.5 Earthing of the workpiece

Where the workpiece is not bonded to earth for electrical safety, nor connected to earth because of its size and position, e.g. ships hull or building steelwork, a connection bonding the workpiece to earth may reduce emissions in some, but not all instances.

Care should be taken to prevent the earthing of the workpiece increasing the risk of injury to users, or damage to other electrical equipment.

Where necessary, the connection of the workpiece to earth should be made by a direct connection to the workpiece, but in some countries where direct connection is not permitted, the bonding should be achieved by suitable capacitance, selected according to national regulations.

2.6 Screening and shielding

Selective screening and shielding of other cables and equipment in the surrounding area may alleviate problems of interference. Screening of the entire welding installation may be considered for special applications.

SPECIFICATIONS

	100E	150TE	
Supply	230V 50Hz 1Ph	230V 50Hz 1Ph	230V 50Hz 1Ph
Fuse Rating	13Amps	13Amps	20Amps
Current Range	24-90A	30-100A	30-150A
Max. Metal Thickness (m/s)	3-4mm	4-5mm	6mm
Welding Wire Sizes	0.6-0.8mm	0.6-0.8mm	0.6-0.8mm
Duty Cycle* 8%	80A	100A	130A
60%	30A	40A	75A
100%	24A	30A	55A
Dimensions (mm)	430X250X370	430X250X370	700X320X580
Weight	24KG	25kg	32kg
Part No.	6010296	6010909	6010141


* Duty Cycle: Determines the machine 'down time'.

e.g. MIG100E, operating at 40 Amps - Duty Cycle - 60%. This means that in ANY 10 minute period, the machine may operate for 6 minutes and must have a down time of 4 minutes.

Please note that the details and specifications contained herein, are correct at the time of going to print. However, CLARKE International reserve the right to change specifications at any time without prior notice. ALWAYS CONSULT THE MACHINE'S DATA PLATE

WIRING DIAGRAMS

MIG PRO-90

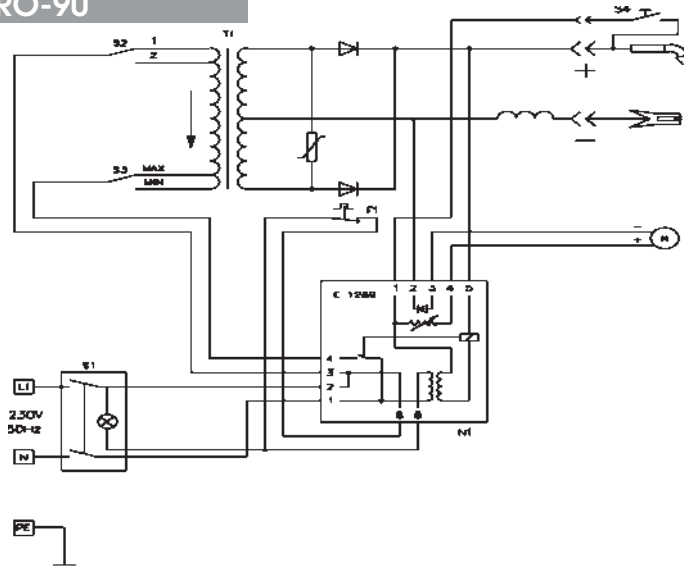

C) Fire and explosion prevention

Causes of fire and explosion are:

- 1) combustibles reached by the arc, flame, flying sparks, hot slag or heated material;
- 2) misuse of compressed gases and cylinders;
- 3) short circuits.

BE AWARE THAT flying sparks or falling slag can pass through cracks, along pipes, through windows or doors, and through wall or floor openings, out of sight of the goggled operator. Sparks and slag can fly 10M.

To prevent fires and explosion: keep equipment clean and operable, free of oil, grease, and (in electrical parts) of metallic particles that can cause short circuits. If combustibles are in area, do NOT weld or cut. Move the work if practicable, to an area free of combustibles.

Avoid paint spray rooms, dip tanks, storage areas, ventilators. If the work cannot be moved, move combustibles at least 10M, away out of reach of sparks and heat; or protect against ignition with suitable and snug fitting, fire-resistant covers or shields.

Walls, ceilings, and floor near work should be protected by heat resistant covers or shields. Fire watcher must be standing by with suitable fire extinguishing equipment during and for some time after welding or cutting if:

- a) appreciable combustibles (including building construction) are within 10M.
- b) appreciable combustibles are further than 10M, but can be ignited by sparks.
- c) openings (concealed or visible) in floors or walls within 10M can expose combustibles to sparks.
- d) combustibles adjacent to walls, ceilings, roofs or metal partitions can be ignited by radiant or conducted heat.

After work is done, check that area is free of sparks, glowing embers, and flames. An empty container that held combustibles, or that can produce flammable or toxic vapours when heated, must never be welded on or cut, unless container has first been cleaned. This includes.....a thorough steam or caustic cleaning (or a solvent or water washing, depending on the combustible's solubility) followed by purging and inerting with nitrogen or carbon dioxide, and using protective equipment.

Water filling just below working level may substitute for inerting.

A container with unknown contents should be cleaned (see paragraph above), do NOT depend on sense of smell or sight to determine if it is safe to weld or cut.

Hollow castings or containers must be vented before welding or cutting - they can explode.

In explosive atmospheres, never weld or cut where the air may contain flammable dust, gas, or liquid vapours.

3. ELECTRIC ARC (MIG, TIG) WELDING

Comply with precautions in 1 above, and this section. Arc welding, properly done, is a safe process, but a careless operator invites trouble. The equipment carries high currents at significant voltages. The arc is very bright and hot. Sparks fly, fumes rise, ultraviolet and infrared energy radiates, weldments are hot. The wise operator avoids unnecessary risks and protects himself and others from accidents.

3A) BURN PROTECTION

Comply with precautions in 2. The welding arc is intense and visibly bright. Its radiation can damage eyes, penetrate lightweight clothing, reflect from light coloured surfaces, and burn the skin and eyes. Skin burns resemble acute sunburn, those from gas - shielded arcs are more severe and painful.

DON'T GET BURNED! COMPLY WITH PRECAUTIONS!

1) Protective clothing

Wear long sleeved clothing (particularly for gas shielded arc) in addition to gloves, apron and shoes (2A). As necessary, use additional protective clothing such as leather jacket or sleeves, flameproof apron, and fire-resistant leggings. Avoid outer garments of untreated cotton. **Bare skin protection:** Wear dark substantial clothing, Button collar to protect chest and neck and button pockets to prevent entry of sparks.

2) Eye and head protection

Protect eyes from exposure to arc. NEVER look at an electric arc without protection. Welding helmet or shield containing a filter plate shade no. 12 or denser must be used when welding. Place over face before striking arc. Protect filter plate with a clear cover plate. Cracked or broken helmet or shield should NOT be worn; radiation can pass through to cause burns. Cracked, broken, or loose filter plates must be replaced IMMEDIATELY. Replace clear cover plate when broken, pitted, or spattered. WE SUGGEST you wear flash goggles with side shields under the helmet, to give some protection to the eyes should the helmet not be lowered over the face before an arc is struck. Looking at an arc momentarily with unprotected eyes (particularly a high intensity gas-shielded arc) can cause a retinal burn that may leave a permanent dark area in the field of vision. Before welding whilst wearing contact lenses, seek advice from your optician.

3) Protection of nearby personnel


For production welding, a separate room or enclosed bay is best. In open areas, surround the operation with low reflective, non- combustible screens or panels. Allow for free air circulation, particularly at floor level. Provide face shields for all persons who will be looking directly at the weld. Others working in the area should wear flash goggles. Before starting to weld, make sure that screen or bay doors are closed.

CONTROL SETTINGS - REFERENCE TABLES

B. MIG 150TE

STEEL	0.6 mm Gas Welding Wire			0.8 mm Gas Welding Wire		
Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment	Welding Position		Wire Speed Adjustment
	A	B	C	A	B	C
0.5 - 0.6	MIN	1	5	MIN	1	5
0.6 - 0.8	MAX	1	5-6	MAX	1	5
0.8 - 1.0	MIN	2	6	MIN	2	5
1.0 - 1.2	MAX	2	6	MAX	2	6
1.2 - 2.0	MIN	3	6	MAX	3	6
2.0 - 3.0	MAX	3	7	MAX	3	6
>3.0	MAX	3	7-8	MAX	3	7

ALUMINIUM	0.8 mm Gas Welding Wire		
Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment
	A	B	C
0.8	MAX	1	6
1.0 - 1.5	MIN	2	8
1.5 - 2.0	MAX	2	8
2.0 - 3.0	MIN	3	9
>3.0	MAX	2/3	10

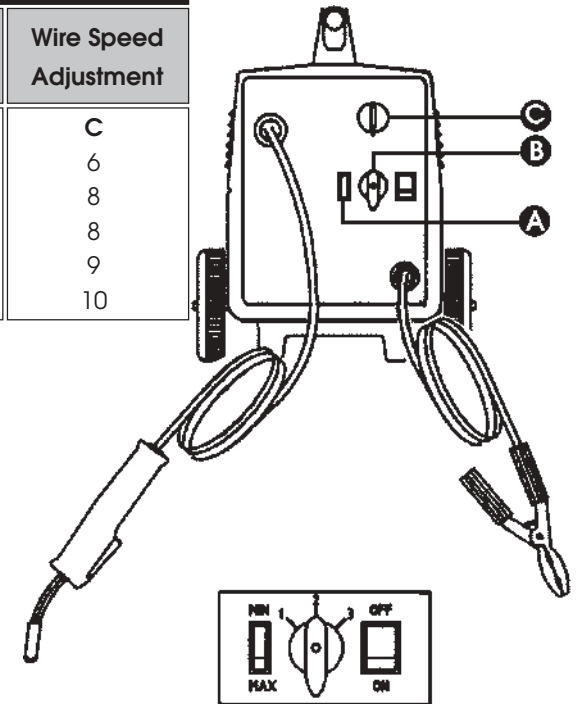


CONTROL SETTINGS - REFERENCE TABLES

B. MIG 100E

STEEL	0.6 mm Gas Welding Wire				0.8 mm Gas Welding Wire			
Workpiece Thickness (mm)	Welding Position			Wire Speed Adjustment	Welding Position			Wire Speed Adjustment
	A	B	C	D	A	B	C	D
0.5 - 0.6	I	2/3	MIN	5				
0.6 - 0.8	I	2/3	MAX	5	A	2	MIN	5
0.8 - 1.0	A	2	MIN	6	A	3	MIN	6
1.0 - 1.2	A	3	MIN	6	A	2	MAX	6
1.2 - 2.0	A	2	MAX	6/7	A	3	MAX	6/7
2.0 - 3.0	A	3	MAX	7/8	A	3	MAX	8

ALUMINIUM	0.8 mm Gas Welding Wire			
Workpiece Thickness (mm)	Welding Position			Wire Speed Adjustment
	A	B	C	D
0.8	I	2/3	MAX	6
1.0 - 1.5	I	2	MIN	6
1.5 - 2.0	A	2	MAX	8
2.0 - 3.00	A	3	MAX	7/8

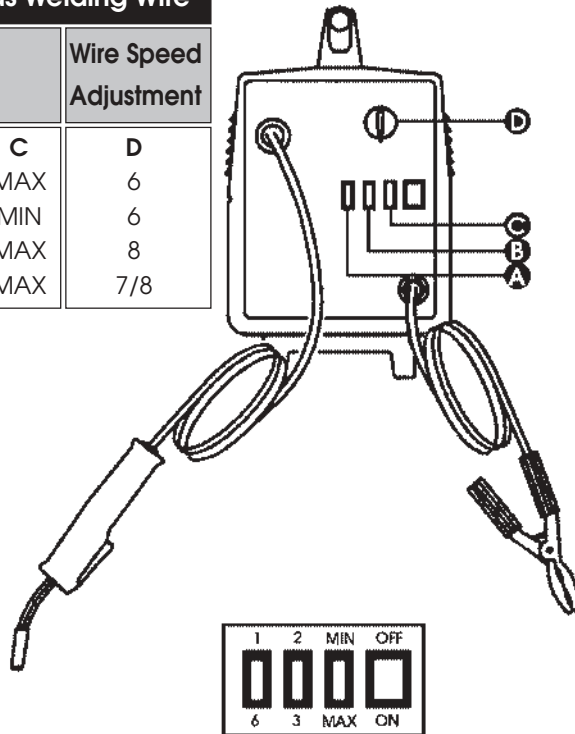

3B) TOXIC FUME PREVENTION

Comply with precautions in 2B. Generator engine exhaust must be vented to the outside air. Carbon monoxide can kill.

3C) FIRE AND EXPLOSION PREVENTION

Comply with precautions in 2C. Equipment's rated capacity. Do not overload arc welding equipment. It may overheat cables and cause a fire. Loose cable connections may overheat or flash and cause a fire. Never strike an arc on a cylinder or other pressure vessel. It creates a brittle area that can cause a violent rupture or lead to such a rupture later under rough handling.

3D) SHOCK PREVENTION

Exposed live conductors or other bare metal in the welding circuit, or in unearthed, electrically-LIVE equipment can fatally shock a person whose body becomes a conductor. DO NOT STAND, SIT, LIE, LEAN ON, OR TOUCH a wet surface when welding, without suitable protection.

3E) PROTECTION FOR WEARERS OF ELECTRONIC LIFE SUPP'T DEVICES (PACEMAKERS)

Magnetic fields from high currents can affect pacemaker operation. Persons wearing electronic life support equipment (pacemaker) should consult with their doctor before going near arc welding, gouging, or spot welding operations.

3F) TO PROTECT AGAINST SHOCK:

Keep body and clothing dry. Never work in damp area without adequate insulation against electrical shock. Stay on a dry duckboard, or rubber mat when dampness or sweat can not be avoided. Sweat, sea water, or moisture between body and an electrically LIVE part - or earthed metal - reduces the body surface electrical resistance, enabling dangerous and possibly lethal currents to flow through the body.

1) Earthing the equipment

When arc welding equipment is earthed according to the National Electrical Code, and the workpiece is earthed, a voltage may exist between the electrode and any conducting object.

Examples of conducting objects include, but are not limited to, buildings, electrical tools, work benches, welding power source cases, workpieces, etc. Never touch the electrode and any metal object unless the welding power source is off. When installing, connect the frames of each unit such as welding power source, control, work table, and water circulator to the building earth.

Conductors must be adequate to carry earth currents safely. Equipment made electrically LIVE by stray current may shock, possibly fatally. Do NOT EARTH to electrical conduit, or to a pipe carrying ANY gas or a flammable liquid such as oil or fuel.

2) Electrode holders

Fully insulated electrode holders should be used. Do NOT use holders with protruding screws or with any form of damage.

3) Connectors

Fully insulated lock-type connectors should be used to join welding cable.

4) Cables

Frequently inspect cables for wear, cracks and damage. IMMEDIATELY REPLACE those with excessively worn or damaged insulation to avoid possibly lethal shock from bared cable. Cables with damaged areas may be taped to give resistance equivalent to original cable. Keep cable dry, free of oil and grease, and protected from hot metal and sparks.

5) Terminals and other exposed parts

Terminals and other exposed parts of electrical units should have insulating covers secured before operation.

6) Electrode

a) Equipment with output on/off control (contactor)

Welding power sources for use with the gas metal arc welding, gas tungsten arc welding and similar processes normally are equipped with devices that permit on/off control of the welding power output. When so equipped the electrode wire becomes electrically LIVE when the power source switch is ON and welding gun switch is closed. Never touch the electrode wire or any conducting object in contact with the electrode circuit unless the welding power source is off.

b) Equipment without output on/off control (no contactor)

Welding power sources used with shielded metal arc welding and similar processes may not be equipped with welding power output on/off control devices. With such equipment the electrode is electrically LIVE when the power switch is turned ON. Never touch the electrode unless the welding power source is off.

7) Safety devices


Safety devices such as interlocks and circuit breakers should not be disconnected or shunted out. Before installation, inspection, or service of equipment, shut OFF all power and remove line fuses (or lock or red-tag switches) to prevent accidental turning ON of power. Do not open power circuit or change polarity while welding. If, in an emergency, it must be disconnected, guard against shock burns, or flash from switch arcing. Always shut OFF and disconnect all power to equipment. Power disconnect switch must be available near the welding power source.

CONTROL SETTINGS - REFERENCE TABLES

A. MIG PRO-90

STEEL	0.6 mm Gas Welding Wire			0.8 mm Gas Welding Wire		
Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment	Welding Position		Wire Speed Adjustment
	A	B	C	A	B	C
0.6 - 0.8	1	MIN	5	1	MIN	5
0.8 - 1.0	2	MIN	5-6	2	MIN	5-6
1.0 - 2.0	1	MAX	6	2	MAX	6
2.0 - 3.0	2	MAX	7	2	MAX	7

ALUMINIUM	0.8 mm Gas Welding Wire		
Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment
	A	B	C
0.8	2	MIN	6
1.0 - 2.0	1	MAX	6
2.0 - 3.0	2	MAX	8

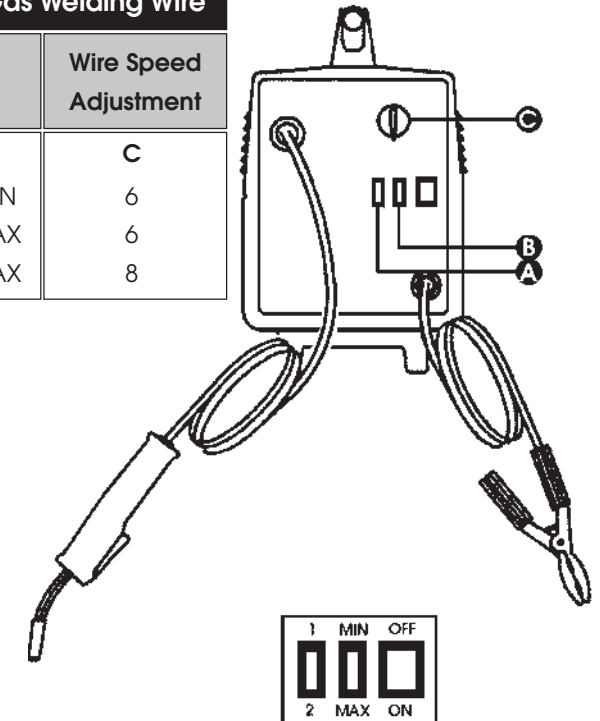

RENEWING THE WIRE LINER

If the liner becomes damaged or kinked, it will be necessary to replace it.

Before commencing work, ensure the gas and electrical supplies are disconnected.

1. Open the side cover, and remove the welding wire from the hose and torch assembly. (Refer to 'Installing Welding Wire' on page 16).
2. Slacken the three screws (W), securing the Hose Support Bracket Cover, slightly...do not remove.
3. Remove the Roller (D)
4. Holding the torch on its side on a flat surface, carefully remove the five securing screws, and gently prise off the uppermost cover, taking care not to disturb the components within, so that you can take note of the exact manner in which they are located, particularly the contact spring (E).
5. Lift out the gas valve (F), and unscrew the liner (H) using a 5/16" spanner on nut (J).
6. Straighten the hose assembly and pull the liner completely out of the hose.
7. Thread the new liner into the hose from the torch end, so that it passes through the Hose Support Bracket Assembly, then connect it to the gas valve and tighten.
8. Reassemble the torch, taking care to ensure that the contact spring (E) and the gas valve (F) are correctly seated. Note that a dowel is used to locate the two halves of the handle. Ensure it is correctly lined up before tightening the five securing screws.
9. Pull the hose so that it is as straight as possible, and leave in this position whilst you retighten the Hose Support Bracket Cover screws (W).
10. Replace the roller on the shaft, where it will butt up against the wire liner. Very carefully, snip off the end of the liner so that a gap of approximately 2-3mm max. exists between the end of the wire liner and the roller. There must be no burrs which could impede the progress of the welding wire. Ensure you use a sharp pair of snips.
11. Push the Roller fully home and secure with the securing knob.

Fig.12


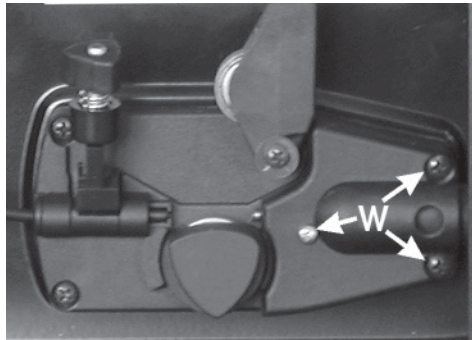


Fig.13

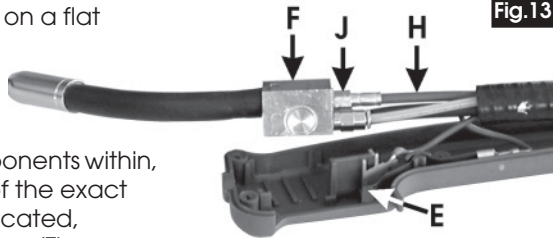

PREPARATION OF THE WORKING AREA

The working area must be sufficiently spacious, not humid, and well-ventilated as to avoid any fumes which develop from the welding process and from incidental material adhering to the pieces to be welded (oils, paints, tars...) which may cause annoyance to the operator.

Avoid welding by contact with humid parts nearby combustible liquids. Least of all, do not weld upon tanks which may contain flammable residuals.

ADDITIONAL SAFETY PRECAUTIONS for MIG WELDING

- ✓ **ALWAYS** ensure that there is full free air circulating around the outer casing of the machine, and that the louvres are unobstructed.
- ✓ Welding arc can seriously damage your eyes. Both operator and spectators must **ALWAYS** use a proper welding face shield or helmet, with suitable filter lenses. Proper gloves and working clothes should be worn at all times.
- ✓ **ALWAYS** check that the pressure regulator and gauges (where fitted), are working correctly. DO NOT lubricate the regulator.
- ✓ **ALWAYS** use the correct regulator. Regulators are designed to be used with a specific gases.
- ✓ **ALWAYS** inspect the hose before use to ensure it is in good condition.
- ✓ **ALWAYS** keep the free length of gas hose outside the work area.
- ✓ **ALWAYS** remove all flammable materials from the welding area.
- ✓ **ALWAYS** Keep fire extinguisher handy....'Dry Powder, CO₂ or BCF, NOT Water
- ✗ **NEVER** remove any of the panels unless the machine is disconnected from the supply, AND never use the machine with any of the panels removed.
- ✗ **NEVER** attempt any electrical or mechanical repair unless you are a qualified technician. If you have a problem with the machine contact your local CLARKE dealer.
- ✗ **NEVER** use or store in a wet/damp environment. DO NOT EXPOSE TO RAIN.
- ✗ The MIG welding process uses an INERT gas to protect the weld pool. It is important to ensure the appropriate gas is being used. **NEVER** use gas from a cylinder, the content of which is unknown.

- X NEVER**
 - a. Use a damaged cylinder.
 - b. Lift the cylinder by the valve.
 - c. Expose the cylinder to a heat source or sparks.
- X NEVER** continue to weld, if, **at any time**, you feel even the smallest electric shock. Stop welding IMMEDIATELY, and DO NOT attempt to use the machine until the fault is diagnosed and corrected.
- X NEVER** point the MIG torch at any person or animal.
- X NEVER** touch the MIG torch nozzle until the welder is switched OFF and the nozzle has been allowed to cool off.
- X NEVER** connect, disconnect, or attempt to service the MIG torch, until the machine is switched OFF and disconnected from the mains supply.
- X NEVER** allow the cables to become wrapped around the operator or any person in the vicinity.

DANGER - ELECTRIC SHOCK CAN BE FATAL.

A person qualified in first aid should always be present in the working area.

If person is unconscious and electric shock is suspected, do not touch the person if he or she is in contact with the welder or cables. Disconnect the welder from the power source and then use First Aid. Dry wood, or other insulating material can be used to move cables, if necessary, away from the person.

MAINTENANCE

WARNING!

**ELECTRICITY CAN KILL.....NEVER TOUCH LIVE ELECTRICAL COMPONENTS
DISCONNECT THE POWER SUPPLY BEFORE ALL INSPECTIONS AND
MAINTENANCE OPERATIONS**

**BEWARE HOT SURFACES.....ALWAYS LET THE POWER SUPPLY COOL DOWN
BEFORE ACCESSING INTERNAL COMPONENTS.**

Frequency of maintenance operations depends on the operating conditions, how intensively the welder is used, and how clean or dirty the welding site is (aggressive atmospheres, etc).

Always inspect the cables, both earth return and torch cable, before use to ensure they are in perfect condition and earth clamp is clean and secured correctly to the cable.

Check the gas hose and Pressure Regulator for security and serviceability, and ensure there is sufficient gas to complete the job in hand.

As a general rule the power supply should be inspected internally at least annually. Consult your CLARKE dealer

THE WELDING SHIELD

Always maintain the welding mask in good condition. If the clear glass protection lens becomes badly pitted, sufficient to interfere with vision, or cracked, have it replaced immediately. Replacement clear and dark lenses are available from your Clarke dealer - see Parts Lists for details. NEVER use any dark filter lens other than that provided by CLARKE International, or one with the same certified 'Optical class' (degree of protection).

The shield should always be cleaned with a clean soft cloth after use, ensuring the lenses are clean. Remove any dust that may have accumulated and store it in a safe place where it cannot be damaged. NEVER use a shield that is **not** in perfect condition.

Thermal Overload

A thermal overload is a safety device which shuts off the welder when the duty cycle has been exceeded. This is to prevent damage to the machine caused by overheating.

When this occurs, the ON/OFF switch will glow (amber). Allow the welder to cool, until the amber light extinguishes before resuming.

For details of the duty cycle...i.e. the length of time the machine may be used at a particular welding current, refer to the data and notes on page 30.

WELDING TIPS

- Try to maintain the tip of the nozzle at an angle of approx. 45° and at a constant distance of approx 5-7mm from the workpiece.
- Try to maintain a constant speed of movement with the torch.
- Do not weld in windy conditions or in an area where ventilation is a problem, or where air flow fluctuates.
- ALWAYS keep the wire and nozzle clean...NEVER use rusted wire.
- Avoid sharp bends or kinks in the welding hose.
- Whenever possible, clean out the wire liner with compressed air when replacing the wire spool.
- Periodically remove the dust, using LOW PRESSURE compressed air, within the casing. Adequate heat dissipation is essential during the welders operation.

SAFETY EQUIPMENT

A comprehensive range of CLARKE safety equipment for use when welding is available from your local dealer.

MIG WELDING - PRINCIPLES OF OPERATION

MIG (Metal Inert Gas) welding is a process in which a power wire electrode is fed continuously into the weld pool at a controlled, constant rate.

The wire is connected to the positive side of a rectified voltage supply. The workpiece is connected to the negative side of the supply.

When the wire is fed, it comes into contact with the workpiece and an arc is struck. The arc melts the wire and the material, fusing it together.

The wire, which is fed by the wire feed motor is fed into the weld pool, burning itself off at a rate dependent upon the selected wire feed speed.

To protect the weld pool from oxidation and impurities during the welding process, a shielding gas flows over and around the weld pool. This gas flow must be sufficient to protect the weld, but not wasteful.

NOTE: Poor gas coverage will result in poor welding. Excessive gas coverage is wasteful and expensive.

BENEFITS OF MIG WELDING

- 50% faster welding time.
- Operator training time kept to a minimum.
- There is no slag removal, thus eliminating almost all post-welding cleaning operations.
- Minimum waste of welding consumables.
- Overall, a faster more efficient way of getting the job done.
- Less heat - less distortion.
- Ability to weld thin material.

ELECTRICAL CONNECTIONS

 **WARNING! THIS APPLIANCE MUST BE EARTHED.**

A. MIG's PRO-90 and 100E ONLY

These welders are fitted with a standard 13 amp BS 1363 plug, fitted with a 13 amp fuse. Connect to a 230 volt (50Hz) domestic electrical supply and **we strongly recommend that this be done via a Residual Current Device (RCD).**

IMPORTANT: If the welder is fitted with a plug which is moulded onto the electric cable (i.e. non- re-wirable) please note:

1. The plug must be thrown away if it is cut from the electric cable. There is a danger of electric shock if it is subsequently inserted into a socket outlet.
2. Never use the plug without the fuse cover fitted.
3. Should you wish to replace a detachable fuse carrier, ensure that the correct replacement is used (as indicated by marking or colour code). Replacement fuse covers can be obtained from your local dealer or most electrical stockists.

Fuse Rating

The fuse in the plug must be replaced with one of the same rating (**13 amps**) and this replacement must be ASTA approved to BS1362.

B. MIG 150TE


Connect the mains lead, through a suitably fused isolator switch, to a 230 Volt (50Hz) electrical supply, with a 20Amp fuse rating. **A standard 13 Amp plug MUST NOT be used with these welders.**

C. ALL MODELS

IMPORTANT: The wires in the mains lead are coloured in accordance with the following code:

*Green & Yellow Earth
Blue Neutral
Brown Live*

As the colours of the flexible cord of this appliance may not correspond with the coloured markings identifying terminals in your plug, proceed as follows:

- Connect GREEN & YELLOW cord to plug terminal marked with a letter "E" or Earth symbol , or coloured GREEN or GREEN & YELLOW.
- Connect BROWN cord to plug terminal marked letter "L" or coloured RED.
- Connect BLUE cord to plug terminal marked letter "N" or coloured BLACK.

Extension Cable

If an extension cable is fitted, ensure the minimum cross section of the conductor is 1.5mm² for up to 15 metres in length, and 2.5mm² for up to 25 metres.

D. Trim the Welding Wire

Trim the welding wire so that it protrudes no more than 5mm from the end of the shroud.

E. Attach the Earth Lead

Attach the earth lead to the workpiece with the earth clamp, as close to the point of weld as possible, without it being intrusive.

Ensure there is good contact, if necessary, clean the area with a wire brush beforehand....Remember, the contact **MUST** be on bare metal - thoroughly clean..

————— **Your welder is now fully prepared for welding.** —————

OPERATION

With the welding current set, and welding wire trimmed, set the wire feed control to 6, (8 for Aluminium). Plug the machine into the mains supply or switch on at the isolator and ensuring all precautions have been taken and with the machine set up correctly, lower the torch to the workpiece with one hand, whilst holding the welding mask in the other.

Approach the work with the tip at an angle of approx. 45° and pull the torch trigger fully. A welding current is now available at the tip and gas will be issued.

As the electrode touches the workpiece, an arc will be struck.....**BEFORE** it is struck, cover the face with the face mask.

Maintain a gap of approx. 5 - 7mm from the workpiece to the tip, and feed the wire into the molten pool at a steady rate, along the line of the proposed weld.

The speed of weld will depend upon the wire speed and welding current.

NOTES:

As MIG welding is an acquired skill, it is strongly advised that, if you are not fully familiar with this type of welding, you practise on a piece of material with the same characteristics as that of your workpiece, until you are satisfied with the result, and you have fine tuned your welder to produce a satisfactory weld.

One of the problems experienced with novice welders, is the welding wire sticking to the contact tip. This is as a result of the wire feed speed being too slow. It is always better therefore to start with too high a speed, and back off slightly, to avoid the possibility of the wire welding itself to the tip. This is the reason position 6 is recommended for start up.

The Wire Feed control is for fine tuning the wire speed. The speed of wire delivery will increase automatically as the current is increased from MIN to MAX, and vice versa. Therefore, once the ideal speed is achieved, by fine tuning, it should not be necessary to adjust this control when the welding current is changed.

Listen to the sound made. An irregular crackling sound denotes too high a wire speed. Decrease the speed until a regular, strong buzzing sound is heard.

1. MIG PRO-90

Two, 2-pole switches are marked 1- 2 and MAX - MIN respectively,


Set these switches according to the charts on pages 27-29.



2. MIG 100E

Three, 2-pole switches are used, marked A - 1, 1 - 2 and MAX - MIN.

Set these switches according to the charts on pages 27-29.

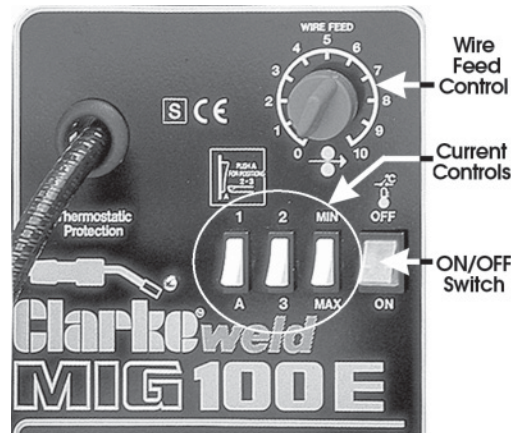

3. MIG 150TE

This model is provided with a single two position switch marked MAX - MIN, and a 3-position rotary switch.

Set these switches according to the charts on pages 27-29.



UNPACKING & PARTS IDENTIFICATION

Unpack and lay out the components, checking against the following list. Any damage or deficiency should be reported to your CLARKE dealer immediately.

Most of the components are stored within the side compartment. To open the compartment, slide the side cover upwards.

PRO MIG-90 & MIG100E

1. Welder complete with Torch and Hose, Earth Cable with Clamp and Power cable.
2. 2xplastic feet w/screws and washers
3. 1xHandle
4. 1x2-Piece Welding Mask
5. 1xWelding Mask handle, complete with plastic nut and 2xplastic screws.
6. 1xPackage containing 1x Clear Glass and 1x Dark Glass Lens
7. 1xMini Wire Spool, fitted to the Spool Holder
8. 1xDisposable Gas Cylinder CO₂
9. 1xGas Regulator
10. 1xLarge Worm Drive Fastening Band
11. 2 alternative welding tips (**1only with PRO-90**)
12. 1xLarge Gas Bottle Adapter (**NOT PRO-90**)

NOTE: A 0.6mm tip is fitted to the torch

MIG150TE

1. Welder complete with Torch and Hose, Earth Cable with Clamp and Power cable.
2. 1 plastic foot
3. 2xWheels w/Axle + 2 Locking washers.
4. 1xHandle Extension w/screw
5. 1xHandle
6. 1x2-Piece Welding Mask
7. 1xWelding Mask handle, complete with plastic nut and 2xplastic screws.
8. 1xPackage containing 1x Clear Glass and 1x Dark Glass Lens
9. 1xMini Wire Spool, (fitted to the Spool Holder)
10. 1xDisposable Gas Cylinder CO₂.
11. 1xGas Regulator
12. 1xLarge Worm Drive Fastening Band
13. 1xLarge Gas Bottle Adapter
13. 1xbag containing
 - a. 1x0.8mm welding tip
 - b. 1x1.0mm welding tip

NOTE: A 0.6mm tip is fitted to the torch



MIG PRO-90 is of similar layout



ASSEMBLY & INSTALLATION

A. Loose Components

PRO-90 & MIG 110E

Lie the welder gently on its side and attach the four feet using the screws and flat washers provided.

MIG 150TE

Insert the axle through the holes in the rear base of the machine, then attach the wheels, securing them by pushing the star locking washers provided, on to the axle, using a piece of tube or an old socket, ensuring the centre lines of the washer face outwards.

Lay the machine gently on its side and attach the foot to the front base using the screw and washer provided.

Attach the handle to the top of the machine by slotting it into place and securing with the screws provided. Slide the handle extension into the handle and secure with the screw provided.

The gas bottle is secured to the machine using the large worm drive fastening band which is threaded through the opening provided on the rear panel of the machine.



B. Installing the Welding Wire

NOTE: These machines are designed to accept either the Clarke 'Mini' or 5kg wire spools of mild steel, stainless steel or aluminium according to the type of metal you wish to weld. Mini Mild Steel wire spools are supplied with the machine..... others must be purchased separately. See 'Accessories' or your Clarke dealer for full details.

1. **IMPORTANT:** Ensure that the gas and electrical supplies are disconnected.
2. (Ref. Fig. 2). To fit the wire spool, firstly open the side compartment by pulling the cover upwards.

Unscrew and remove the plastic knob (A), followed by the spring and collar B) and finally the wire spool. (If the spool is already fitted during initial assembly, remove the plastic covering).

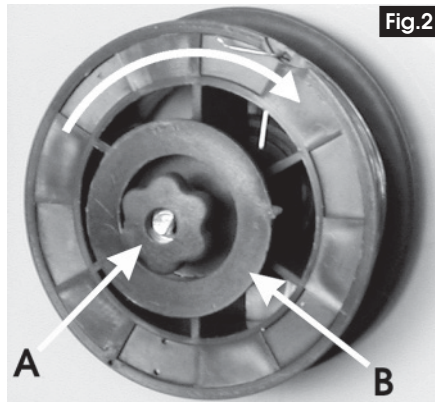


Fig.2

3. Slide the spool on to the shaft, ensuring that it sits snugly, and the direction of feed of the wire is in the direction of the arrow.

PREPARATION FOR USE

A. PREPARE THE WORK

MOST IMPORTANT!

It is VITAL that the workpiece is perfectly clean at the point of weld. Any coating, plating or corrosion MUST be removed, otherwise a good weld will be impossible to achieve.

B. SET THE CONTROLS

In order to produce a satisfactory weld, the controls must be fine tuned whenever there is a material change in weld characteristics.

Three sets of controls are provided....

(i) ON/OFF,

The ON/OFF switch is self explanatory, but serves a secondary function. You will note that it is coloured amber. The switch doubles as a lamp, which will illuminate if the Thermal Overload intervenes.

(ii) WIRE FEED SPEED CONTROL.

The WIRE FEED Rotary Control Knob, with graduations from 0 to 10, is used to control the wire speed feed to the nozzle.

The knob should be set to position 6 to begin with for welding steel, and 8 for welding aluminium, then adjusted as required.

Note: This control is for fine tuning the wire speed. The speed of wire delivery will increase automatically as the current is increased and vice versa. Therefore, once the ideal speed is achieved by fine tuning, it should not be necessary to adjust this control when the welding current is changed.

It is always better to start with too high a speed, and back off slightly, to avoid the possibility of the wire welding itself to the tip.

(iii) WELDING CURRENT CONTROLS

Controls differ from model to model and are described as follows:

B. ASSEMBLING THE WELDING SHIELD

To assemble the welding shield, insert the clear glass panel first, followed by the dark glass panel into the recess in the shield, i.e. the clear glass MUST be on the outside of the shield. Securing them with the plastic screws provided.

Slot the two pieces together as shown, and enter the threaded end of the handle through the holes provided. Thread on the plastic nut and tighten.

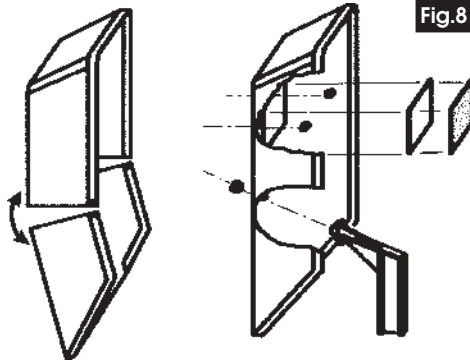


Fig.8

It is important to pay attention to the notes on welding shield maintenance, given on page 25. When replacing the glass panels, use ONLY those parts supplied by Clarke International. The dark panel is a certified, specific optical class, and should not be exchanged for any other type.

The clear glass panel should be replaced when it becomes badly pitted.

WARNING:

NEVER look at an electric arc without eye protection as this can injure the eyes permanently. ALWAYS use a protection mask or welding helmet.

All components are now correctly assembled, and the welder may now be prepared for operation, as follows:

Replace the collar, spring and plastic knob, tightening the knob sufficiently to allow the spool to rotate smoothly but with a slight amount of braking friction. Do not over tighten as this will exert undue pressure on the wire drive motor and may cause serious damage.

(Ref. Figs. 3)

- Loosen the plastic knob (A) by turning it anticlockwise, (this device maintains pressure on the wire).
- Pull, on the plastic knob, so that the screw rod hinges out of its slot. This releases the pivoted pressure roller bracket (C). Raise the bracket, in the direction of the arrow, and pull out any wire that has been left in the wire liner (D), pulling it from the nozzle end of the hose.

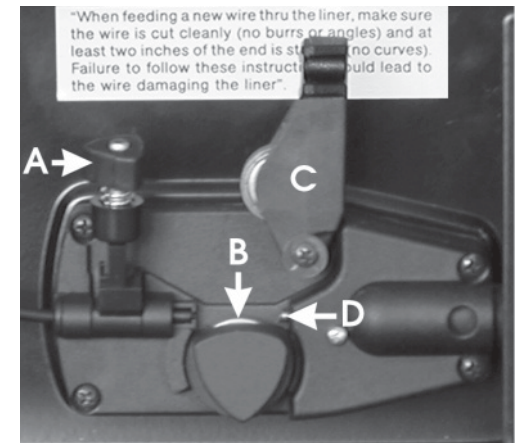


Fig.3

IMPORTANT!

If you are changing the size of wire, you must also select the appropriate groove on the feed roller. See p. 18

- Re: Fig.4**

Pull out the end of the wire from the rim of the spool, taking care NOT to release it. The spool is wound firmly and should remain this way.

Ensuring the wire is straight and not kinked in any way, clip off the end are no burrs or sharp edges. Proceed to feed it through the guide tube (E), over the groove on the roller (B), and into the wire liner (D), by about 10 - 15 cm.

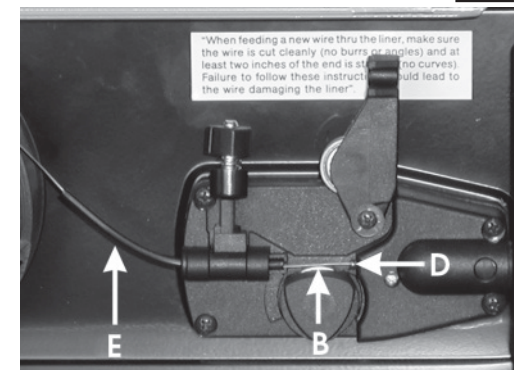


Fig.4


- Reposition the pressure roller bracket (C, FIG.3) and plastic knob (A, Fig.3) and tighten slightly.

Tightening the knob (A) too tightly will crush the wire and damage the wire feed motor, too loose will not allow the wire to be pulled by the roller.

8. (Ref. Fig 5)

Unscrew and remove the torch shroud by twisting it anti clockwise, then unscrew the contact tip.

Should any wire protrude from the tip....pull it out completely and discard.

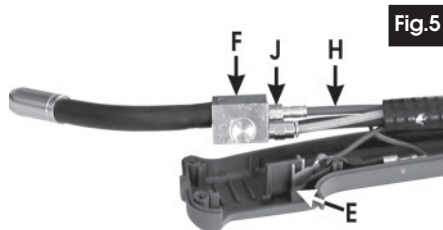

9. Close the side panel of the machine, plug into a 230V, 50HZ outlet (or switch on isolator).
10. Set the Wire Feed rotary switch, on the front panel, to position 6 OR 7, switch on the machine and press the trigger.

The wire will feed through the hose and when it appears at the torch end, release the trigger, switch off the machine and disconnect from the mains supply. Replace the contact tip and the torch shroud.

IMPORTANT:

Ensure the hose is kept straight during this operation, to assist the wire as it is fed through to the wire liner and torch.


D. Selecting the Correct Drive Roller Groove

As previously mentioned, it is important that the correct groove in the drive roller is selected for the particular wire being used. Two grooves, 7mm and 8mm are provided.

The 7mm groove should be used with 6mm dia. wire and the 9mm groove for all 8mm wire. The welder s factory set with the 9mm groove in position.


To change to the other groove, proceed as follows:

1. With the pressure roller bracket raised, and the old wire removed, as shown, turn the roller securing knob (A), fully anticlockwise, as indicated in Fig.7, and pull it from the shaft, followed by the roller.
2. Turn the roller through 180°, replace it on the shaft, followed by the securing knob, which should then be turned fully clockwise to lock the roller securely in place.

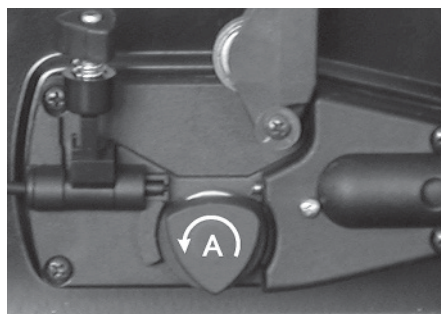

C. The Gas Supply

A mini gas bottle complete with gas regulator is provided. Should you prefer to use larger gas cylinders, the appropriate gas regulator and fittings need to be acquired. Your Clarke dealer will be happy to advise in this regard.

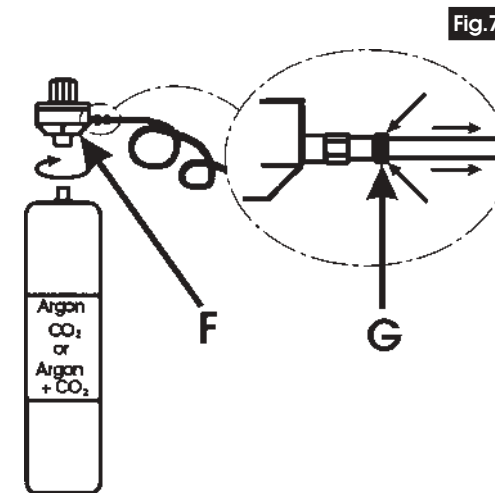

1. Remove the protective cap from the cylinder outlet and screw on the regulator (F), fully, BUT DO NOT OVERTIGHTEN.
2. Simply push the gas hose, at the rear of the machine, into the gas regulator outlet, as far as possible and release. This is a self sealing coupling.

To remove the hose, hold back the ring (G) then pull the hose out.

Always use the appropriate gas for the material being welded. Three types are provided by Clarke International, as follows:

Carbon Dioxide (CO ₂)	For Mild Steel	Part No. 6000642
Argon	For Aluminium	Part No. 6000661
CO2/Argon Mix	For Thin Sheet metal	
	Mild Steel/ Stainless	Part No. 6000660
Additionally a larger CO2 bottle is available		Part No. 6000643
Replacement Gas Regulator		Part No. 8132000